

IMPORTANT: Provide this information to employees, customers, and users of this product. Read this SDS before handling or disposing of this product. This product is covered by the OSHA Hazard Communication Standard and this document has been prepared in accordance with requirements of this standard. All abbreviated terms used in this SDS are further described in Section 16.

### 1. Identification

This Safety Data Sheet is available in American Spanish upon request. Los Datos de Serguridad pueden obtenerse en Espanol si lo riquiere.

Product Name:	Landau Top & Trim High Solid Heat Resistant VOC Compliant Adhesive	Revision Date:	1/14/2019
Product UPC Number:	070798002500, 070798002524	Supercedes Date:	11/14/2016
Product Use/Class:	Adhesive	SDS No:	00030528001
Manufacturer:	DAP Products Inc. 2400 Boston Street Suite 200 Baltimore, MD 21224-4723 888-327-8477 (non - emergency matters) SDS Coordinator: MSDS@dap.com Emergency Telephone: Transportation: 1-800-535 -5053 1-352-323-3500 Poison Control: 1-800-222-1222	Preparer:	Regulatory and Environmental Affairs

# 2. Hazards Identification

# GHS Classification

Eye Irrit. 2, Flam. Liq. 1, Skin Irrit. 2, STOT RE 2, STOT SE 3 NE

Symbol(s) of Product



Signal Word Danger

### **Possible Hazards**

92% of the mixture consists of ingredients of unknown acute toxicity

### **GHS HAZARD STATEMENTS**

Flammable Liquid, category 1	H224	Extremely flammable liquid and vapour.
Skin Irritation, category 2	H315	Causes skin irritation.
Eye Irritation, category 2	H319	Causes serious eye irritation.
STOT, single exposure, category 3, NE	H336	May cause drowsiness or dizziness.
STOT, repeated exposure, category 2	H373	May cause damage to organs through prolonged or repeated exposure.

### GHS LABEL PRECAUTIONARY STATEMENTS

P210	Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
P260	Do not breathe dust/fume/gas/mist/vapours/spray.
P264	Wash thoroughly after handling.
P271	Use only outdoors or in a well-ventilated area.
P280	Wear protective gloves/protective clothing/eye protection/face protection.
P302+P352	IF ON SKIN: Wash with plenty of soap and water.
P303+P361+P353	IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water/shower.
P304+P340	IF INHALED: Remove person to fresh air and keep comfortable for breathing.
P305+P351+P338	IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.
P312	Call a POISON CENTER or doctor/physician if you feel unwell.
P321	Specific treatment (see on this label).
P332+P313	If skin irritation occurs: Get medical advice/attention.
P337+P313	If eye irritation persists: Get medical advice/attention.
P362	Take off contaminated clothing.
P370+P378	In case of fire: Use to extinguish.
P403+P233	Store in a well-ventilated place. Keep container tightly closed.
P403+P235	Store in a well-ventilated place. Keep cool.
P405	Store locked up.
P501	Dispose of contents/container to
GHS SDS PRECAUTIONARY STATEM	ENTS
P240	Ground/bond container and receiving equipment.
P241	Use explosion-proof electrical/ventilating/lighting// equipment.
P242	Use only non-sparking tools.
P243	Take precautionary measures against static discharge.

# 3. Composition/Information on Ingredients

Chemical Name	CAS-No.	Wt. % GHS Symbols	GHS Statements
Acetone	67-64-1	15-40 GHS02-GHS07	H225-319-336
n-Hexane	110-54-3	10-30 GHS02-GHS07- GHS08	H225-304-315-336-373
Polychlorinated Rubber	9010-98-4	10-30 No Information	No Information
Toluene	108-88-3	5-10 GHS02-GHS07- GHS08	H225-304-315-332-335-336-373
Methylcyclopentane	96-37-7	1-5 GHS08	H304
3-Methylpentane	96-14-0	1-5 GHS02-GHS07- GHS08	H225-304-315-336

SDS Number: 00030528001	SAP Number:			Revision Date: 1/14/2019
2-Methylpentane	107-83-5	1-5	GHS02-GHS07- GHS08	H225-304-315-336
Magnesium oxide fume	1309-48-4	0.5-1.5	No Information	No Information

The text for GHS Hazard Statements shown above (if any) is given in the "Other information" Section.

### 4. First-aid Measures

**FIRST AID - INHALATION:** If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention immediately. NOTE: Only trained personnel should administer artificial respiration or give oxygen.

**FIRST AID - SKIN CONTACT:** Wash skin with soap and water for 15 minutes. Get medical aid if symptoms persist. Remove and wash contaminated clothing. DO NOT try to peel the solidified material from the skin or use solvents or thinners to dissolve it. The use of vegetable oil or mineral oil is recommended for removal of this material from the skin. Flush exposed area with water while removing contaminated clothing. Get medical attention if irritation persists. To remove from skin, remove completely with a dry cloth or paper towel, before washing with detergent and water.

FIRST AID - EYE CONTACT: If material gets into eyes, flush with water immediately for 15 minutes. Consult a physician.

FIRST AID - INGESTION: If swallowed, DO NOT INDUCE VOMITING. Get medical attention immediately.

### 5. Fire-fighting Measures

**UNUSUAL FIRE AND EXPLOSION HAZARDS:** Eliminate sources of ignition: heat, electrical equipment, sparks and flames. Vapors can form an ignitable mixture with air. Vapors can flow along surfaces to a distant ignition source and flash back. Vapors may form explosive mixtures with air. Containers may explode if exposed to extreme heat. Empty containers retain product residue (liquid and/or vapor). Vapor can ignite potentially causing an explosion.

**SPECIAL FIREFIGHTING PROCEDURES:** Wear self-contained breathing apparatus pressure-demand (NIOSH approved or equivalent) and full protective gear. Use water spray to cool exposed surfaces. Cool fire-exposed containers using water spray.

EXTINGUISHING MEDIA: Alcohol Foam, Carbon Dioxide, Dry Chemical, Foam, Water Fog

### 6. Accidental Release Measures

#### ENVIRONMENTAL MEASURES: No Information

**STEPS TO BE TAKEN IF MATERIAL IS RELEASED OR SPILLED:** NOTE: Review fire hazards before proceeding with clean up. Immediately eliminate sources of ignition. Keep people away from and upwind of spill/leak. Contain spilled material and remove with inert absorbent. Dispose of contaminated absorbent, container and unused contents in accordance with local, state and federal regulations. Prevent product from entering drains. Soak up with inert absorbent material and dispose of as hazardous waste. Read all product instructions before using. Personal protective equipment should include impervious gloves, protective eye wear, and suitable work clothes. Scrape up dried material and place into containers.

### 7. Handling and Storage

HANDLING: KEEP OUT OF REACH OF CHILDREN!DO NOT TAKE INTERNALLY. Remove all sources of ignition. Keep away from open flames, hot surfaces and sources of ignition. Provide adequate ventilation. Avoid heat, sparks and open flames. Wear appropriate personal protection. Avoid breathing vapor and contact with eyes, skin and clothing. Use in well ventilated area. Open all windows and doors or use other means to ensure cross-ventilation and fresh air entry during application and drying. Odor is not an adequate warning for hazardous conditions. Empty containers retain product residue (liquid and/or vapor). Vapor can ignite potentially causing an explosion. Wash thoroughly after handling. Do not use in areas where static sparks may be generated. Intentional misuse by deliberately concentrating and inhaling vapors may be harmful or fatal. Construction and repair activities can adversely affect indoor air quality. Consult with occupants or a representative (i.e. maintenance, building manager, industrial hygienist, or safety officer) to determine ways to minimize impact.

**STORAGE:** Store away from sources of ignition and heat. Do not store at temperatures above 120 degrees F. Store containers away from excessive heat and freezing. Store away from caustics and oxidizers. Keep containers tightly closed.

### 8. Exposure Controls/Personal Protection

Ingredients with Occupational Expos Chemical Name	ure Limits ACGIH TLV-TWA	ACGIH-TLV STEL	OSHA PEL-TWA	OSHA PEL-CEILING
Acetone	250 ppm TWA	500 ppm STEL	1000 ppm TWA, 2400 mg/m3 TWA	N.E.
n-Hexane	50 ppm TWA	N.E.	500 ppm TWA, 1800 mg/m3 TWA	N.E.
Polychlorinated Rubber	N.E.	N.E.	N.E.	N.E.
Toluene	20 ppm TWA	N.E.	200 ppm TWA	300 ppm Ceiling
Methylcyclopentane	N.E.	N.E.	N.E.	N.E.

SDS Number: 00030528001	SAP Num	nber:	F	Revision Date: 1/14/2019
3-Methylpentane	500 ppm TWA Hexane isomers other than n-hexane	1000 ppm STEL Hexane isomers other than n-hexane	N.E.	N.E.
2-Methylpentane	500 ppm TWA Hexane isomers other than n-hexane	1000 ppm STEL Hexane isomers other than n-hexane	N.E.	N.E.
Magnesium oxide fume	10 mg/m3 TWA inhalable particulate matter	N.E.	15 mg/m3 TWA fume, total particulate	N.E.

Further Advice: MEL = Maximum Exposure Limit OES = Occupational Exposure Standard SUP = Supplier's Recommendation Sk = Skin Sensitizer N.E. = Not Established

#### Personal Protection



**RESPIRATORY PROTECTION:** A NIOSH-approved air purifying respirator with an organic vapor cartridge or canister may be necessary under certain circumstances where airborne concentrations are expected to exceed exposure limits. If concentrations exceed the exposure limits specified, use of a NIOSH-approved supplied air respirator is recommended. Where the protection factor is exceeded, use of a Self Contained Breathing Apparatus (SCBA) may be necessary. If you experience eye watering, headache or dizziness or if air monitoring demonstrates vapor/mist levels are above applicable limits, wear and appropriate, properly fitted respirator (NIOSH approved) during and after application. A respiratory protection program that meets the OSHA 1910.134 and ANSI Z88.2 requirements must be followed whenever workplace conditions warrant a respirator's use.



SKIN PROTECTION: Solvent-resistant gloves.



EYE PROTECTION: Goggles or safety glasses with side shields.



OTHER PROTECTIVE EQUIPMENT: Provide eyewash and solvent impervious apron if body contact may occur.



HYGIENIC PRACTICES: Remove and wash contaminated clothing before re-use.

### 9. Physical and Chemical Properties

Appearance: Odor: Density, g/cm3: Freeze Point, °C: Solubility in Water: Decomposition Temperature, °C: Boiling Range, °C: Minimum Flash Point, °C: Evaporation Rate:	Amber Solvent 0.82 - 0.82 Not Established No Information Not Established N.E N.E. -45.5 Not Established	Physical State: Odor Threshold: pH: Viscosity (mPa.s): Partition Coeff., n-octanol/water: Explosive Limits, %: Auto-Ignition Temperature, °C Vapor Pressure, mmHg: Flash Method:	Thick Liquid Not Established Not Applicable Not Established Not Established N.E N.E. Not Established Not Established Pensky-Martens Closed Cup
Vapor Density:	Not Applicable	Flammability, NFPA:	Flammable Liquid
Combustibility:	Does not support combustion		Class IA

(See "Other information" Section for abbreviation legend) (If product is an aerosol, the flash point stated above is that of the propellant.)

# 10. Stability and Reactivity

**STABILITY:** Stable under recommended storage conditions.

**CONDITIONS TO AVOID:** Keep away from open flames, hot surfaces and sources of ignition. Keep away from oxidizing agents, strongly alkaline and strongly acid materials in order to avoid exothermic reactions. Avoid contact with skin, eyes and clothing. Do not smoke.

**INCOMPATIBILITY:** Open flames, hot surfaces and sources of ignition. Keep away from strong oxidizing agents, heat and open flames. Exothermic reaction with strong acids. Strong oxidizers, alkali metals and alkaline earth metals may cause fires or explosions.

HAZARDOUS DECOMPOSITION PRODUCTS: Normal decomposition products, i.e., COx, NOx.

### 11. Toxicological Information

**EFFECT OF OVEREXPOSURE - INHALATION:** Inhalation of vapors may cause irritation of the nose, throat, lungs and respiratory tract. Inhalation of vapors in high concentration may cause shortness of breath (lung edema). Intentional misuse by deliberately concentrating and inhaling the contents may be harmful or fatal. Prolonged, repeated or high exposures may cause central nervous system depression leading to headaches, nausea, drowsiness, dizziness, and possibly narcosis. In extreme cases, may cause loss of consciousness.

**EFFECT OF OVEREXPOSURE - SKIN CONTACT:** Harmful if absorbed through the skin. May cause skin irritation. Prolonged and repeated skin contact may cause dermatitis, drying and defatting due to the solvent properties.

**EFFECT OF OVEREXPOSURE - EYE CONTACT:** May cause eye irritation. Signs and symptoms may include: pain, tears, swelling, redness and blurred vision.

**EFFECT OF OVEREXPOSURE - INGESTION:** Harmful or fatal if swallowed. May cause gastrointestinal disturbances with dizziness and central nervous system depression. If ingested, may cause depressed respiration. Ingestion may cause gastrointestinal irritation, nausea, vomiting and diarrhea. Aspiration hazard if swallowed. Aspiration of material into the lungs due to vomiting can cause chemical pneumonitis, which can be fatal.

#### CARCINOGENICITY: No Information

**EFFECT OF OVEREXPOSURE - CHRONIC HAZARDS:** Repeated or prolonged exposure may cause skin, respiratory, kidney and liver damage. May cause kidney and liver damage as well as developmental and reproductive toxicity. Prolonged or repeated inhalation of solvent vapors may cause irregular heartbeat. NOTICE: Reports have associated repeated and prolonged occupational overexposure to solvents with permanent brain and nervous system damage. Symptoms include: loss of memory, loss of intellectual ability and loss of coordination. Intentional misuse by deliberately concentrating and inhaling the contents may be harmful or fatal. Overexposure or misuse of toluene can cause liver, kidney, and brain damage as well as cardiac abnormalities. There have been cases of aplastic anemia from toluene in industrial exposures (ACGIH, 1992). Increased coagulation time and reduced clotting factors have also been found, which are indicators of damage to the bone marrow (Clayton & Clayton, 1994). n-Hexane exposure can cause nerve damage to arms and legs causing numbness of the fingers and toes, effect may be permanent. Symptoms include: loss of memory, loss of intellectual ability and loss of coordination.

PRIMARY ROUTE(S) OF ENTRY: Skin Contact, Skin Absorption, Inhalation

#### **Acute Toxicity Values**

The acute effects of this product have not been tested. Data on individual components are tabulated below

<u>CAS-No.</u> 67-64-1	Chemical Name Acetone	<u>Oral LD50</u> 5250 mg/kg mouse	<mark>Dermal LD50</mark> ≥15688 mg/kg rabbit	<u>Vapor LC50</u> 50 mg/L Rat
110-54-3	n-Hexane	25000 mg/kg Rat	3000 mg/kg Rabbit	> 31.86 mg/L Rat
9010-98-4	Polychlorinated Rubber	>5000 mg/kg Rat	N.I.	N.I.
108-88-3	Toluene	2600 mg/kg Rat	12000 mg/kg Rabbit	12.5 mg/L Rat
96-37-7	Methylcyclopentane	28710 mg/kg Rat	3000 mg/kg Rabbit	> 31.86 mg/L Rat
96-14-0	3-Methylpentane	28710 mg/kg Rat	3000 mg/kg Rabbit	> 31.86 mg/L Rat
107-83-5	2-Methylpentane	28710 mg/kg Rat	3000 mg/kg Rabbit	> 31.86 mg/L Rat
1309-48-4	Magnesium oxide fume	>3870 mg/kg Rat	N.I.	N.I.

N.I. = No Information

### 12. Ecological Information

ECOLOGICAL INFORMATION: Ecological injuries are not known or expected under normal use.

### 13. Disposal Information

**DISPOSAL INFORMATION:** Residues and spilled material are hazardous waste due to ignitability. Dispose of material in accordance with all federal, state and local regulations. State and Local regulations/restrictions are complex and may differ from Federal regulations. Responsibility for proper waste disposal is with the owner of the waste. Liquids cannot be disposed of in a landfill. Do not flush into surface water or sanitary sewer system. Do not empty into drains. Do not re-use empty containers. The container for this product can present explosion or fire hazards, even when emptied. To avoid risk of injury, do not cut, puncture, or weld on or near this container.

**STEPS TO BE TAKEN IF MATERIAL IS RELEASED OR SPILLED:** NOTE: Review fire hazards before proceeding with clean up. Immediately eliminate sources of ignition. Keep people away from and upwind of spill/leak. Contain spilled material and remove with inert absorbent. Dispose of contaminated absorbent, container and unused contents in accordance with local, state and federal regulations. Prevent product from entering drains. Soak up with inert absorbent material and dispose of as hazardous waste. Read all product instructions before using. Personal protective equipment should include impervious gloves, protective eye wear, and suitable work clothes. Scrape up dried material and place into containers.

### 14. Transport Information

SPECIAL TRANSPORT PRECAUTIONS: No Information

DOT UN/NA Number:	UN1133
DOT Proper Shipping Name: DOT Technical Name:	Adhesives, containing a flammable liquid N.A.
DOT Hazard Class:	3 Flammable liquid
Hazard SubClass:	N.A.
Packing Group:	111

## 15. Regulatory Information

#### SARA SECTION 313:

This product contains the following substances subject to the reporting requirements of Section 313 of Title III of the Superfund Amendment and Reauthorization Act of 1986 and 40 CFR part 372:

<u>Chemical Name</u>	<u>CAS-No.</u>
n-Hexane	110-54-3
Toluene	108-88-3

### TOXIC SUBSTANCES CONTROL ACT:

All ingredients in this product are either on TSCA inventory list, or otherwise exempt. This product contains the following chemical substances subject to the reporting requirements of TSCA 12(B) if exported from the United States:

No TSCA 12(b) components exist in this product.


SAP Number:

#### 16. Other Information **Revision Date:** 1/14/2019 Supersedes Date: 11/14/2016 **Revision Description Changed** Reason for revision: Product Composition Changed Substance and/or Product Properties Changed in Section(s): 01 - Product Information 05 - Flammability Information 09 - Physical & Chemical Information 11 - Toxicological Information 13 - Disposal Information 14 - Transportation Information 15 - Regulatory Information 16 - Other Information Revision Statement(s) Changed **Regulatory Department** Datasheet produced by: **HMIS Ratings:** Health: Flammability: **Reactivity:** Personal Protection: 3\* 4 1 Х VOC Less Water Less Exempt Solvent, g/L: 540.0 VOC Material, g/L: 346 VOC as Defined by California Consumer Product Regulation, Wt/Wt%: 42.0 VOC Actual, Wt/Wt%: 42.0

Text for GHS Hazard Statements shown in Section 3 describing each ingredient:

H225	Highly flammable liquid and vapour.
H304	May be fatal if swallowed and enters airways.
H315	Causes skin irritation.
H319	Causes serious eye irritation.
H332	Harmful if inhaled.
H335	May cause respiratory irritation.
H336	May cause drowsiness or dizziness.
H373	May cause damage to organs through prolonged or repeated exposure.

Icons for GHS Pictograms shown in Section 3 describing each ingredient:

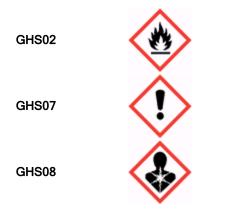

Legend: N.A. - Not Applicable, N.E. - Not Established, N.D. - Not Determined

DAP believes the data and statements contained herein are accurate as of the date hereof. They are offered in good faith as typical values and not as a product specification. NO WARRANTY OF MERCHANTABILITY, WARRANTY OF FITNESS FOR ANY PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED, IS MADE WITH REGARD TO THE INFORMATION HEREIN PROVIDED OR THE PRODUCT TO WHICH THE INFORMATION REFERS. Since this document is intended only as a guide to the appropriate use and precautionary handling of the referenced product by a properly trained person, it is therefore the responsibility of the user to (i) review the recommendations with due consideration for the specific context of the intended use and (ii) determine if they are appropriate.